


WITNESS MONUMENT TIES			
ID	BEARING	DIST.	DESCRIPTION
Witness A	S 32d W	66.2'	Northeast corner of Sherwin Williams building
MONUMENT ACCESSORIES			
Other survey grade monuments that were located in the vicinity and their relation to the monument.			
(#368)	N 27d12'44" E	42.11'	3118116.94, 1429500.83 Cut + in northwest corner back of curb inlet
(#369)	N 37d52'35" W	53.33'	3118064.94, 1429505.48 Cut + in northwest corner back of curb inlet
(#370)	S 58d18'33" W	41.08'	3118062.73, 1429441.80 Cut + in south rim of storm manhole
(#10398)	S 0d54'21" E	21.51'	3118098.03, 1429441.88 $\frac{5}{8}$ " rebar with broken yellow plastic cap stamped "SNA INC LS FIRM 0101" found flush on the east side of the south (back) entrance to Sherwin Williams
(#10401)	S 78d37'54" E	84.32'	3118180.35, 1429446.76 Cut + in southeast corner back of curb inlet

#### NOTES:

- Field work was performed on September 25, 2018 and October 19, 2018.
- Monroe County Surveyor's Field Book 52, page 47.
- Project Name: INDOT Network 2018, Field work by: RSO & TER, Drawn by: RSO, Reviewed by: RSO, TER & SRB.
- The basis of bearings is Grid North NAD83(2011), Indiana West Zone, Epoch 2010.0000, Geoid Model G2012BU7, Datum NAD83\_NO\_TRANS, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Distances obtained with GPS have not been adjusted to ground. Coordinate data was collected with a Javad Triumph LS Network Rover and a Sokkia Set 510 Total Station.
- Vicinity sketch was compiled per 2017 aerial photography.
- This monument was witnessed by the Monroe County Surveyor, Kevin Enright, on August 7, 2012 and accepted by the Monroe County Surveyor Review Board on August 21, 2012. We collected coordinates on the known monument in preparation for an upcoming INDOT resurfacing project in the area. Historic research has not yet been performed to prove the validity of this monument.

▲ **Monument Description:** Mag nail with washer stamped "SNA INC LS FIRM 0101" found flush

**State Plane Grid Coordinates:** Point No.:10179 Northing: 1429463.38', Easting: 3118097.68'

SHEET 1 OF 2	<b>MONUMENT RECORD</b>	<b>Quarter Corner</b>		<b>OFFICE OF THE MONROE COUNTY SURVEYOR</b> <b>Trohn Enright-Randolph</b> Monroe County Surveyor <b>Rachel Savich Oser</b> Professional Surveyor 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
	CORNER ID: <b>Blm_Q23</b>	Section 34 & 35- T09N-R01W Bloomington Township Monroe County, Indiana		

Photos were taken on 09/25/2018 with an iPhone 6s



*Trohn Enright-Randolph*  
Trohn Enright-Randolph  
Monroe County Surveyor



Accepted by the Monroe  
County Surveyor Review Board  
on 12/06/2018



*Rachel Oser*  
Rachel Savich Oser, State of Indiana  
Professional Surveyor No. 21100022

SHEET  
2  
OF  
2

**MONUMENT RECORD**  
CORNER ID:  
**Blm\_Q23**

**Quarter Corner**  
Section 34 & 35- T09N-R01W  
Bloomington Township  
Monroe County, Indiana



**OFFICE OF THE MONROE COUNTY SURVEYOR**  
Trohn Enright-Randolph *Monroe County Surveyor*  
Rachel Savich Oser *Professional Surveyor*  
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570



MONUMENT RECORD  
State of Indiana - County of Monroe

Section: 34

Township: 9 North



Range: 1 West

Corner ID: Blm Q-23

**Monument Description & Remarks:** MAG nail (set) in East State Road 48. Survey Sign not set

**References On File:** Douglas R. Curry survey, Tenth & the Bypass (1999), on file in Recorder Office cabinet HB envelope 153 and Bernard A. Guerrettaz survey, 10th and the Bypass (2012), on file in Recorder Office cabinet S2 envelope 61

RECOVERY TIE DRAWING  
Field Book 46 Page No. 54

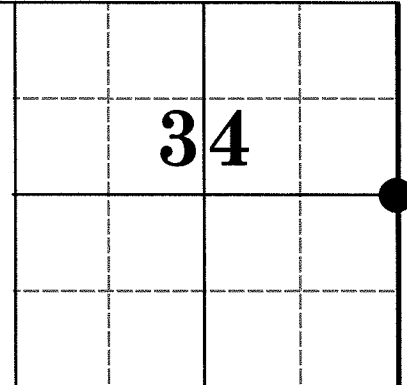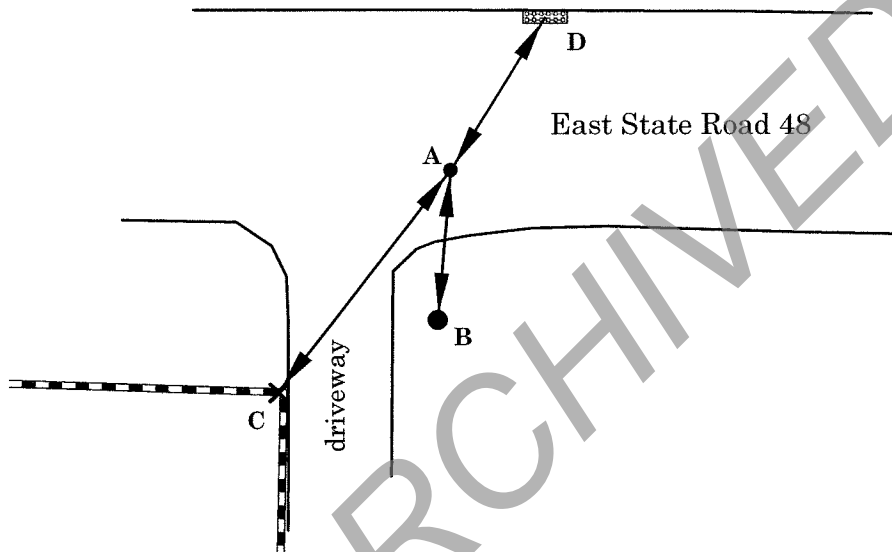

- A - MAG nail
- B - S 05°W 35.25' to 5/8"  
Rebar with cap, "BRG"
- C - S 38°W 66.2' to North East  
corner of Brick Building
- D - N 32°E 42.23' to "X" on  
storm drain



Not To Scale  
Compass Bearing Magnetic North

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-13 of the Indiana Code; and the above data is given under my hand and seal this 7th day of August, 2012.

Administered by the Monroe County Surveyor Review Board

08-21-2012

